


New and replaced articles in Webshop

We update continuously the content in our Webshop and in this Service News you will find changes made during the period 2019-04-27 – 2019-09-10. First you will find products which are replacing existing or have been discontinued. After that comes, for Webshop, new products. A simple sectioning in different product categories is made to give a better overview.

News – new design of non-return valve for bottom filling

We can now present an improved solution of non-return valve for bottom filling. The pictures below show the complete part and the non-return flap itself.

- The nut towards the tank outlet has been provided with knobs which simplifies assembly and disassembly at the outlet.
- The non-return valve has a new design which improves the function when opening and closing. It has also a bigger dimension, $\varnothing 51$ mm, for improved throughput.
- The non-return valve has a new seat which minimizes the risk for milk residues after cleaning.
- Connection of the hose fitting is now with a clamp with a large sized wing nut which simplifies mounting and dismounting for control and cleaning.

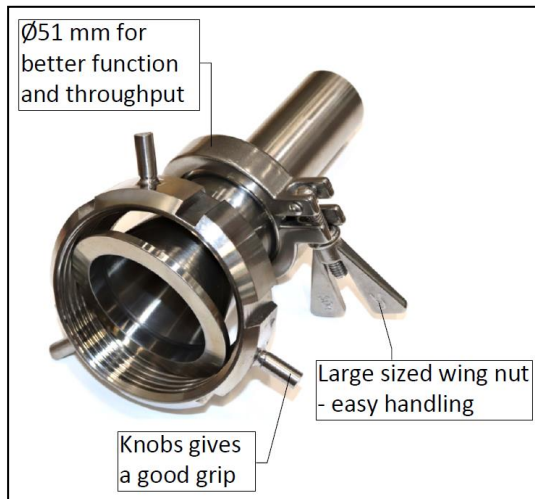

Complete equipment for bottom filling



New non-return flap Ø51 mm

➤ **NEW/REPLACED – Non-return valve for bottom filling SMS 63.5/51 with $\varnothing 38$ mm hose connection $\varnothing 38$ mm**

- 32051852 Non-return valve for bottom filling of milk tank, coupling nut SMS 63.5, hose connection $\varnothing 38$ mm – *replaces 32051552*
- 32051853 Non-return valve for bottom filling of milk tank, coupling nut SMS 51, hose connection $\varnothing 38$ mm – *replaces 32027752*
- 32051856 Non-return valve for bottom filling of milk tank, coupling nut DIN 65, hose connection $\varnothing 38$ mm – *replaces 32029551*
- 32051857 Non-return valve for bottom filling of milk tank, coupling nut DIN 50, hose connection $\varnothing 38$ mm – *replaces 32034451*

➤ **REPLACED – Non-return valve for bottom filling SMS 51 with $\varnothing 25$ mm hose connection**

- 32062852 Bottom filling of milk tank, hose connection $\varnothing 25$ mm, coupling nut SMS 51

➤ **NEW/REPLACED – Time relay**


833655 Time relay 1s-100h, 24-240VAC/DC – *replaces 833665*



➤ **NEW/REPLACED – Heater**

The heaters now come equipped with a drain plug. The drain plug will ensure that all condensing water will be drained from the heater to ensure that the heater will not freeze when being transported or not used. The heat element inside of the heater is also replaced by a much more stable element with higher quality.

- 841176 Heater 7,5 kW 3x230V with drain plug – *replaces 841136*
- **Note!** 841136 is still valid until stock is empty, then 841176 will be introduced
- 841177 Heater 7,5 kW 3x400V with drain plug – *replaces 841137*
- 841178 Heater 10 kW 3x400V with drain plug – *replaces 841138*

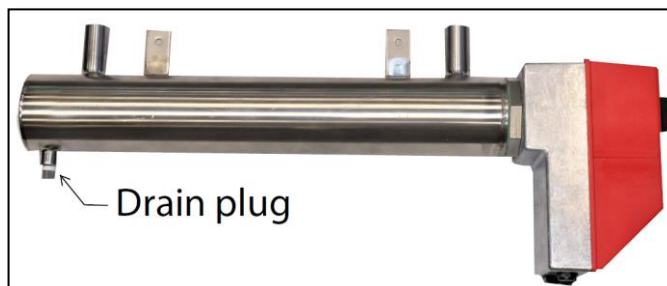

➤ **NEW – Cleaning parts**

- 31361851 Cleaning device RN41 connection 38
- 31960451 Curved cleaning pipe $\varnothing 51$ mm (outside dimensions 266x135x51 mm)
- 855102 Pump, SE-15A, 0,55 kW, 230/400V, 50hz, 3000 r/m, $\varnothing 75$ mm
- 855104 Pump, SE-15A, 0,25 kW, 3x230/400V, 50hz, 1450 r/m, $\varnothing 105$ mm
- 855105 Pump, SE-15A, 0,55 kW, 3x230/400V, 50Hz, 3000 r/m, $\varnothing 105$ mm

Service News 2019/nr 2

- 855106 Pump, SE-20C, 2,2 kW, 3x230/400V, 50hz, 3000 r/m, Ø145 mm



➤ NEW – Fan components


- 691714 Fan impeller 406 mm

➤ NEW – Control system

- 21376151 Bottom part - enclosure Argos/Nautilus 2 - including rubber gasket
- 691753 Front printed circuit WinMaster CL2 **incl. lid and sticker**



21376151

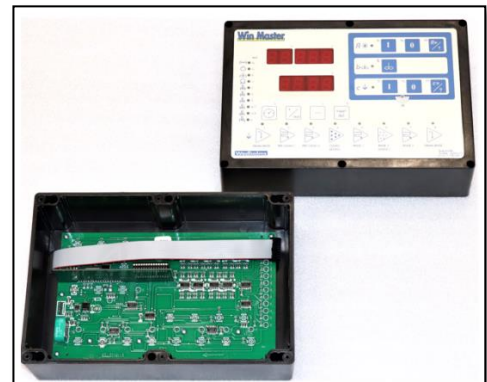

691753

➤ NEW/REPLACED – Tank parts

- 32034201 Support console condenser (right)
- 32034301 Support console condenser (left)
- 801711 Housing for welding Ø25 mm
- 620522 Adjustable leg 45x13-M10x60
- 10641251 Agitator Laser tank, 14000-18000 litre – *replaces 10611251*
- 10642351 Agitator Laser tank, 20000-30000 litre – *replaces 10611351*
- 21381051 Ladder 9000-18000 litres tanks, DF953L (9000-12000 litres) / DF95L – *replaces 21334651*

➤ NEW – Electrical details

- 696029 Lid screw box

➤ NEW – Aftermarket

- 21331069 Interpac, double sheathed, 16 plates complete kit

Service News 2019/nr 2

- 803024 Flap valve for non-return valve Ø51 mm for bottom filling delivered 2019-06 or later
- 41917852 Hose connection Ø25 and coupling with nut SMS 63.5
- 41912251 Transition flange for Clamp Ø51 to nipple SMS 25

In case of questions and comments about the content in this Service News please contact:

Wedholms technical group

Mail: support@wedholms.se

In case of questions about ordering of spare parts and Aftermarket products please contact:

Mail: spareparts@wedholms.se

Phone: +46 155 280 381